



November 29, 2016

Cincinnati Public Schools
Cynthia Eghbalnia
2651 Burnet Avenue
Cincinnati, OH 45219

**Dater Montessori
School**

Dear Cynthia:

Attached please find the results of the lead analyses performed for Dater Montessori School by the Greater Cincinnati Water Works (GCWW). The following comments speak to the process, samples analyzed and additional steps needed to help ensure the safety of all the students within the school.

School Sampling Process and Results

GCWW and Cincinnati Public Schools (CPS) staff worked together to finalize a sampling plan for the school. The *USEPA 3Ts for Reducing Lead in Drinking Water in Schools: Revised Technical Guidance Document (3Ts Guidelines)* is the process and guidelines used for assisting schools with testing for lead.

In October, one hundred, seventy-seven (177) samples were collected from drinking fountains and sinks throughout the school. Multiple sinks within the school were not initially considered for testing, however, key nearby indicators (coffee makers, drinking cups, plates, utensils, etc.) prompted these locations to be tested. Including these sampling locations speaks to the proactive approach CPS continues to have towards understanding the water quality within the schools. Two additional locations were not sampled [drinking fountains]. The results show the following:

- 151 samples (85.31%), below the detection level (<1)
- 23 samples (12.99%), between 1ppb and 5ppb
- 3 samples (1.70%), between 5ppb and 10ppb

Approximately fifteen percent (14.69%) of the samples analyzed had some level of lead detection; 100% of the sample results were below the federal action level.

Fifteen parts per billion (ppb) is the federal Lead and Copper Rule action level; desired results are below 15. The federal action level of 15ppb pertains to water utilities and GCWW's review and comments are based on this action level. However, the USEPA 3Ts Guidelines document outlines practices for schools to put in place if samples are greater than 20 ppb.

While we strive to have results less than 15, we recognize that lead is a pervasive environmental contaminant, and no safe blood lead threshold has been identified in children or adults. Therefore, we provide recommendations to further reduce any lead levels discovered at drinking water and cooking outlets.

Next steps

GCWW has reviewed the results from your samples and provides some next-steps comments:

1. Although lower than the 15 ppb action level, for samples with lead detections at drinking fountains and cooking outlets (kitchen, stockpot filler locations), consider flushing the lines before using the water. Refer to the USEPA 3Ts Guidelines for more information.




2. For sinks with lead detections, and as a precautionary measure, consider signage above sinks that indicates hand washing only or communications throughout the school that expresses this. Refer to the USEPA 3Ts Guidelines for more information to reduce the risk of lead.
3. Although a number of samples had minimum lead detections at this time, consider completing a plumbing profile to review the fixtures in the school as some fixtures may be contributing to the lead detections in samples. If the fixtures are the source of the lead, plan to replace them. The USEPA 3Ts Guidelines outlines a great approach to creating and implementing a remediation plan. A copy of the Guidelines can be found on our website <http://www.cincinnati-oh.gov/water/assets/File/3T%20Guidance%20Manual%20for%20Schools.pdf>.

State funds are available through the new Lead Plumbing Fixture Replacement Assistance Grant Program established to provide reimbursement to eligible schools for the assessment and replacement of certain plumbing fixtures. The program is open to traditional public schools, community schools, and chartered non-public schools. Program information can be found on the Ohio Facilities Construction Commission (OFCC) Services and Programs website <http://ofcc.ohio.gov/ServicesPrograms/LeadFixtureReplacementGrants.aspx>.

4. If it hasn't occurred already, a robust communications plan is suggested. Communications plan steps are outlined in the 3Ts Guidelines. This plan will inform the school community of the sampling work the school has done to date and the steps the school will take to correct any issues discovered. GCWW employees can assist with this plan and are available to attend any school meetings to help explain our lead program, the sample results and our partnership with CPS. Sampling results will be posted on the GCWW lead.mygcww.org website with other school sampling results.

Greater Cincinnati Water Works takes the presence of lead service lines and the removal of those service lines in our system very seriously. In addition, minimizing the exposure of lead within our preschools, schools, and daycares is one of our highest priorities under our Enhanced Lead Program. We look forward to our continued partnership with Cincinnati Public Schools. Our resources are available to assist in many ways. Please contact Jim Nelson at 591-6869 to discuss how we can assist with next steps within your school.

Sincerely,

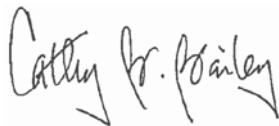

Cathy B. Bailey
Director/Greater Cincinnati Water Works

Cc: Dr. Marilyn Crumpton, Cincinnati Health Department
Dr. Camille Jones, Cincinnati Health Department
Chuck DeJonckheere, Hamilton County Public Health
Sheila Hill-Christian, City of Cincinnati
Verna Arnette, Greater Cincinnati Water Works
Jeff Swertfeger, Greater Cincinnati Water Works

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT1	Dater Montessori School	10/26/2016	6:33	CPS_DAT_BASEMENT_0010WORKRMSINK_DAT1	Lead, ppb	1.37	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT2	Dater Montessori School	10/26/2016	6:32	CPS_DAT_BASEMENT_GIRLSRR_LSINK_DAT2	Lead, ppb	<1	Less than detection level
DAT3	Dater Montessori School	10/26/2016	6:32	CPS_DAT_BASEMENT_GIRLSRR_LSINK_DAT3	Lead, ppb	<1	Less than detection level
DAT4	Dater Montessori School	10/26/2016	6:34	CPS_DAT_BASEMENT_HALLWAYNEAR0009_LDF_DAT4	Lead, ppb	<1	Less than detection level
DAT5	Dater Montessori School	10/26/2016	6:34	CPS_DAT_BASEMENT_HALLWAYNEAR0009_RDF_DAT5	Lead, ppb	<1	Less than detection level
DAT6	Dater Montessori School	10/26/2016	6:34	CPS_DAT_BASEMENT_BOYSRR_LSINK_DAT6	Lead, ppb	<1	Less than detection level
DAT7	Dater Montessori School	10/26/2016	6:34	CPS_DAT_BASEMENT_BOYSRR_RSINK_DAT7	Lead, ppb	<1	Less than detection level
DAT8	Dater Montessori School	10/26/2016	6:36	CPS_DAT_BASEMENT_B003_SINK_DAT8	Lead, ppb	1.12	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT9	Dater Montessori School	10/26/2016	6:36	CPS_DAT_BASEMENT_B001_SINK_DAT9	Lead, ppb	2.4	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT10	Dater Montessori School	10/26/2016	6:37	CPS_DAT_BASEMENT_B002_SINK_DAT10	Lead, ppb	1.08	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT11	Dater Montessori School	10/26/2016	6:37	CPS_DAT_BASEMENT_B004_SINK_DAT11	Lead, ppb	<1	Less than detection level
DAT12	Dater Montessori School	10/26/2016	6:37	CPS_DAT_BASEMENT_0013STAFFRR_SINK_DAT12	Lead, ppb	1.98	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT13	Dater Montessori School	10/26/2016	6:44	CPS_DAT_FL1_HALLWAYMAINENT_DF_DAT13	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT14	Dater Montessori School	10/26/2016	6:44	CPS_DAT_FL1_GYM1008PEOFFRR_SINK_DAT14	Lead, ppb	1.62	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT15	Dater Montessori School	10/26/2016	6:45	CPS_DAT_FL1_1301COFFEESHOP_SINK_DAT15	Lead, ppb	<1	Less than detection level
DAT16	Dater Montessori School	10/26/2016	6:45	CPS_DAT_FL1_1301COFFEESHOP_IM_DAT16	Lead, ppb	<1	Less than detection level
DAT17	Dater Montessori School	10/26/2016	6:46	CPS_DAT_FL1_MAINTENTBOYSRR_LSINK_DAT17	Lead, ppb	<1	Less than detection level
DAT18	Dater Montessori School	10/26/2016	6:46	CPS_DAT_FL1_MAINTENTBOYSRR_RSINK_DAT18	Lead, ppb	<1	Less than detection level
DAT19	Dater Montessori School	10/26/2016	6:47	CPS_DAT_FL1_MAINTENTGIRLSRR_LSINK_DAT19	Lead, ppb	2	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT20	Dater Montessori School	10/26/2016	6:47	CPS_DAT_FL1_MAINTENTGIRLSRR_RSINK_DAT20	Lead, ppb	1.35	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT21	Dater Montessori School	10/26/2016	6:47	CPS_DAT_FL1_1025CLINIC_SINK_DAT21	Lead, ppb	<1	Less than detection level
DAT22	Dater Montessori School	10/26/2016	6:47	CPS_DAT_FL1_1025CLINICRR_SINK_DAT22	Lead, ppb	<1	Less than detection level
DAT23	Dater Montessori School	10/26/2016	6:51	CPS_DAT_FL1_1023MAINOFFICERR_SINK_DAT23	Lead, ppb	<1	Less than detection level
DAT24	Dater Montessori School	10/26/2016	6:51	CPS_DAT_FL1_1019MAINOFFICEWORKRM_SINK_DAT24	Lead, ppb	<1	Less than detection level
DAT25	Dater Montessori School	10/26/2016	6:51	CPS_DAT_FL1_1010GIRLSRR_SINK_DAT25	Lead, ppb	<1	Less than detection level
DAT26	Dater Montessori School	10/26/2016	6:51	CPS_DAT_FL1_1011BOYSRR_SINK_DAT26	Lead, ppb	<1	Less than detection level
DAT27	Dater Montessori School	10/26/2016	6:53	CPS_DAT_FL1_1028LIBRARYWORKRM_SINK_DAT27	Lead, ppb	<1	Less than detection level
DAT28	Dater Montessori School	10/26/2016	6:24	CPS_DAT_CAFETERIA_COMBODF_DAT28	Lead, ppb	<1	Less than detection level
DAT29	Dater Montessori School	10/26/2016	6:24	CPS_DAT_FL1_CAFETERIA_COMBOBF_DAT29	Lead, ppb	<1	Less than detection level
DAT30	Dater Montessori School	10/26/2016	6:13	CPS_DAT_KITCHEN_WASHRM_LUTILITYSINK_DAT30	Lead, ppb	<1	Less than detection level
DAT31	Dater Montessori School	10/26/2016	6:14	CPS_DAT_KITCHEN_WASHRM_RUTILITYSINK_DAT31	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT32	Dater Montessori School	10/26/2016	6:19	CPS_DAT_KITCHEN_WASHRM_HANDSINK_DAT32	Lead, ppb	2.51	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT33	Dater Montessori School	10/26/2016	6:16	CPS_DAT_KITCHEN_LSERVE_HANDSINK_DAT33	Lead, ppb	1.38	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT34	Dater Montessori School	10/26/2016	6:16	CPS_DAT_KITCHEN_RSERVE_HANDSINK_DAT34	Lead, ppb	<1	Less than detection level
DAT35	Dater Montessori School	10/26/2016	6:20	CPS_DAT_KITCHEN_RSERVE_UTILITYSINK_DAT35	Lead, ppb	<1	Less than detection level
DAT36	Dater Montessori School	10/26/2016	6:20	CPS_DAT_KITCHEN_FRONT_UTILITYSINK_DAT36	Lead, ppb	<1	Less than detection level
DAT37	Dater Montessori School	10/26/2016	6:21	CPS_DAT_KITCHEN_BACKPRODUCE_UTILITYSINK_DAT37	Lead, ppb	<1	Less than detection level
DAT38	Dater Montessori School	10/26/2016	6:21	CPS_DAT_KITCHEN_BACKPRODUCE_HANDSINK_DAT38	Lead, ppb	<1	Less than detection level
DAT39	Dater Montessori School	10/26/2016	6:23	CPS_DAT_KITCHEN_STOCKPOT_LFILLER_DAT39	Lead, ppb	<1	Less than detection level
DAT40	Dater Montessori School	10/26/2016	6:23	CPS_DAT_KITCHEN_STOCKPOT_RFILLER_DAT40	Lead, ppb	<1	Less than detection level
DAT41	Dater Montessori School	10/26/2016	6:28	CPS_DAT_FL1_CAFE_1036STAFFWORK_SINK_DAT41	Lead, ppb	<1	Less than detection level
DAT42	Dater Montessori School	10/26/2016	6:28	CPS_DAT_FL1_STAFFRRNEAR1047_SINK_DAT42	Lead, ppb	<1	Less than detection level
DAT43	Dater Montessori School	10/26/2016	6:56	CPS_DAT_FL1_1042BOYSRR_LSINK_DAT43	Lead, ppb	<1	Less than detection level
DAT44	Dater Montessori School	10/26/2016	6:56	CPS_DAT_FL1_1042BOYSRR_RSINK_DAT44	Lead, ppb	<1	Less than detection level
DAT45	Dater Montessori School	10/26/2016	6:56	CPS_DAT_FL1_1041GIRLSRR_LSINK_DAT45	Lead, ppb	<1	Less than detection level
DAT46	Dater Montessori School	10/26/2016	6:56	CPS_DAT_FL1_1041GIRLSRR_RSINK_DAT46	Lead, ppb	<1	Less than detection level
DAT47	Dater Montessori School	10/26/2016	6:56	CPS_DAT_FL1_HALLWAYNEAR1042_DF_DAT47	Lead, ppb	<1	Less than detection level
DAT48	Dater Montessori School	10/26/2016	6:59	CPS_DAT_FL1_1036_LSINK_DAT48	Lead, ppb	<1	Less than detection level
DAT49	Dater Montessori School	10/26/2016	6:59	CPS_DAT_FL1_1306_LDF_DAT49	Lead, ppb	<1	Less than detection level
DAT50	Dater Montessori School	10/26/2016	6:59	CPS_DAT_FL1_1306_RSINK_DAT50	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT51	Dater Montessori School	10/26/2016	6:59	CPS_DAT_FL1_1306_RDF_DAT51	Lead, ppb	<1	Less than detection level
DAT52	Dater Montessori School	10/26/2016	7:05	CPS_DAT_FL1_1307STAFFRR_SINK_DAT52	Lead, ppb	<1	Less than detection level
DAT53	Dater Montessori School	10/26/2016	7:03	CPS_DAT_FL1_1309_SINK_DAT53	Lead, ppb	<1	Less than detection level
DAT54	Dater Montessori School	10/26/2016	7:06	CPS_DAT_FL1_1309_DF_DAT54	Lead, ppb	<1	Less than detection level
DAT55	Dater Montessori School	10/26/2016	7:06	CPS_DAT_FL1_1310_SINK_DAT55	Lead, ppb	1.07	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT56	Dater Montessori School	10/26/2016	7:07	CPS_DAT_FL1_1310_DF_DAT56	Lead, ppb	<1	Less than detection level
DAT57	Dater Montessori School	10/26/2016	7:07	CPS_DAT_FL1_1311_SINK_DAT57	Lead, ppb	<1	Less than detection level
DAT58	Dater Montessori School	10/26/2016	7:07	CPS_FL1_DAT_1311_DF_DAT58	Lead, ppb	<1	Less than detection level
DAT59	Dater Montessori School	10/26/2016	7:09	CPS_DAT_FL1_1312_SINK_DAT59	Lead, ppb	<1	Less than detection level
DAT60	Dater Montessori School	10/26/2016	7:09	CPS_DAT_FL1_1312_DF_DAT60	Lead, ppb	<1	Less than detection level
DAT61	Dater Montessori School	10/26/2016	7:10	CPS_DAAT_FL1_1313STAFFWORK_SINK_DAT61	Lead, ppb	<1	Less than detection level
DAT62	Dater Montessori School	10/26/2016	7:10	CPS_DAT_FL1_1313STAFFWORK_DF_DAT62	Lead, ppb	<1	Less than detection level
DAT63	Dater Montessori School	10/26/2016	7:11	CPS_DAT_1313STAFFWOMENSRR_SINK_DAT63	Lead, ppb	1.02	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT64	Dater Montessori School	10/26/2016	7:11	CPS_DAT_FL1_1313STAFFWORKMENSRR_SINK_DAT64	Lead, ppb	1.05	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT65	Dater Montessori School	N/A	N/A	CPS_DAT_FL1_HALLWAYNEAR1316_DF	Lead, ppb	N/A	sample location not working.
DAT66	Dater Montessori School	10/26/2016	7:12	CPS_DAT_FL1_1316GIRLSRR_FLSINK_DAT66	Lead, ppb	<1	Less than detection level
DAT67	Dater Montessori School	10/26/2016	7:12	CPS_DAT_FL1_1316GIRLSRR_LSINK_DAT67	Lead, ppb	<1	Less than detection level
DAT68	Dater Montessori School	10/26/2016	7:12	CPS_DAT_FL1_1316GIRLSRR_RSINK_DAT68	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT69	Dater Montessori School	10/26/2016	7:12	CPS_DAT_FL1_1316GIRLSRR_FRSINK_DAT69	Lead, ppb	<1	Less than detection level
DAT70	Dater Montessori School	10/26/2016	7:14	CPS_DAT_FL1_1317BOYSRR_FLSINK_DAT70	Lead, ppb	<1	Less than detection level
DAT71	Dater Montessori School	10/26/2016	7:14	CPS_DAT_FL1_1317BOYSRR_LSINK_DAT71	Lead, ppb	<1	Less than detection level
DAT72	Dater Montessori School	10/26/2016	7:14	CPS_DAT_FL1_1317BOYSRR_RSINK_DAT72	Lead, ppb	<1	Less than detection level
DAT73	Dater Montessori School	10/26/2016	7:14	CPS_DAT_FL1_1317FOYSRR_FRSINK_DAT73	Lead, ppb	<1	Less than detection level
DAT74	Dater Montessori School	10/26/2016	7:16	CPS_DAT_FL1_1320_SINK_DAT74	Lead, ppb	1.52	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT75	Dater Montessori School	10/26/2016	7:16	CPS_DAT_FL1_1320_LDF_DAT75	Lead, ppb	<1	Less than detection level
DAT76	Dater Montessori School	10/26/2016	7:17	CPS_DAT_FL1_1320_RSINK_DAT76	Lead, ppb	<1	Less than detection level
DAT77	Dater Montessori School	10/26/2016	7:17	CPS_DAT_FL1_1320_RDF_DAT77	Lead, ppb	<1	Less than detection level
DAT78	Dater Montessori School	10/26/2016	7:18	CPS_DAT_FL1_1321_SINK_DAT78	Lead, ppb	1.07	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT79	Dater Montessori School	10/26/2016	7:18	CPS_DAT_FL1_1321_DF_DAT79	Lead, ppb	<1	Less than detection level
DAT80	Dater Montessori School	10/26/2016	7:19	CPS_DAT_FL1_1322_LSINK_DAT80	Lead, ppb	<1	Less than detection level
DAT81	Dater Montessori School	10/26/2016	7:19	CPS_DAT_FL1_1322_LDF_DAT81	Lead, ppb	<1	Less than detection level
DAT82	Dater Montessori School	10/26/2016	7:20	CPS_DAT_FL1_1322_RSINK_DAT82	Lead, ppb	1.51	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT83	Dater Montessori School	10/26/2016	7:20	CPS_DAT_FL1_1322_RDF_DAT83	Lead, ppb	<1	Less than detection level
DAT84	Dater Montessori School	10/26/2016	7:20	CPS_DAT_FL1_1325_SINK_DAT84	Lead, ppb	<1	Less than detection level
DAT85	Dater Montessori School	10/26/2016	7:20	CPS_DAT_FL1_1325_DF_DAT85	Lead, ppb	<1	Less than detection level
DAT86	Dater Montessori School	10/26/2016	7:22	CPS_DAT_FL1_1324_SINK_DAT86	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT87	Dater Montessori School	10/26/2016	7:22	CPS_DAT_FL1_1324_DF_DAT87	Lead, ppb	<1	Less than detection level
DAT88	Dater Montessori School	10/26/2016	7:26	CPS_DAT_FL1_1323LSIDE_FSINK_DAT88	Lead, ppb	<1	Less than detection level
DAT89	Dater Montessori School	10/26/2016	7:26	CPS_DAT_FL1_1323LSIDE_BSINK_DAT89	Lead, ppb	<1	Less than detection level
DAT90	Dater Montessori School	10/26/2016	7:26	CPS_DAT_FL1_1323RSIDE_FSINK_DAT90	Lead, ppb	<1	Less than detection level
DAT91	Dater Montessori School	10/26/2016	7:26	CPS_DAT_FL1_1323RSIDE_BSINK_DAT91	Lead, ppb	<1	Less than detection level
DAT92	Dater Montessori School	10/26/2016	7:26	CPS_DAT_FL1_1327_SINK_DAT92	Lead, ppb	<1	Less than detection level
DAT93	Dater Montessori School	10/26/2016	7:26	CPS_DAT_FL1_1327_DF_DAT93	Lead, ppb	<1	Less than detection level
DAT94	Dater Montessori School	10/26/2016	7:27	CPS_DAT_FL1_1328_LSINK_DAT94	Lead, ppb	<1	Less than detection level
DAT95	Dater Montessori School	10/26/2016	7:27	CPS_DAT_FL1_1328_LDF_DAT95	Lead, ppb	<1	Less than detection level
DAT96	Dater Montessori School	10/26/2016	7:28	CPS_DAT_FL1_1328_RSINK_DAT96	Lead, ppb	<1	Less than detection level
DAT97	Dater Montessori School	10/26/2016	7:28	CPS_DAT_FL1_1328_RDF_DAT97	Lead, ppb	<1	Less than detection level
DAT98	Dater Montessori School	10/26/2016	7:29	CPS_DAT_FL1_1329_SINK_DAT98	Lead, ppb	<1	Less than detection level
DAT99	Dater Montessori School	10/26/2016	7:29	CPS_DAT_FL1_1329_DF_DAT99	Lead, ppb	<1	Less than detection level
DAT100	Dater Montessori School	10/26/2016	7:30	CPS_DAT_FL1_1330_SINK_DAT100	Lead, ppb	<1	Less than detection level
DAT101	Dater Montessori School	10/26/2016	7:30	CPS_DAT_FL1_1330_DF_DAT101	Lead, ppb	<1	Less than detection level
DAT102	Dater Montessori School	10/26/2016	7:32	CPS_DAT_FL1_1123_SINK_DAT102	Lead, ppb	<1	Less than detection level
DAT103	Dater Montessori School	10/26/2016	7:32	CPS_DAT_FL1_1123_DF_DAT103	Lead, ppb	<1	Less than detection level
DAT104	Dater Montessori School	10/26/2016	7:34	CPS_DAT_FL1_1123RR_SINK_DAT104	Lead, ppb	<1	Less than detection level
DAT105	Dater Montessori School	10/26/2016	7:35	CPS_DAT_FL1_1122_SINK_DAT105	Lead, ppb	<1	Less than detection level
DAT106	Dater Montessori School	10/26/2016	7:35	CPS_DAT_FL1_1122_DF_DAT106	Lead, ppb	<1	Less than detection level
DAT107	Dater Montessori School	10/26/2016	7:35	CPS_DAT_FL1_1122RR_SINK_DAT107	Lead, ppb	<1	Less than detection level
DAT108	Dater Montessori School	10/26/2016	7:36	CPS_DAT_FL1_1121_SINK_DAT108	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT109	Dater Montessori School	10/26/2016	7:36	CPS_DAT_FL1_1121_DF_DAT109	Lead, ppb	<1	Less than detection level
DAT110	Dater Montessori School	10/26/2016	7:36	CPS_DAT_FL1_1121RR_SINK_DAT110	Lead, ppb	<1	Less than detection level
DAT111	Dater Montessori School	10/26/2016	7:37	CPS_DAT_FL1_1120_SINK_DAT111	Lead, ppb	<1	Less than detection level
DAT112	Dater Montessori School	10/26/2016	7:37	CPS_DAT_FL1_1120_DF_DAT112	Lead, ppb	<1	Less than detection level
DAT113	Dater Montessori School	10/26/2016	7:37	CPS_DAT_FL1_1120RR_SINK_DAT113	Lead, ppb	<1	Less than detection level
DAT114	Dater Montessori School	10/26/2016	7:38	CPS_DAT_FL1_1115NATURECENTER_LSINK_DAT114	Lead, ppb	<1	Less than detection level
DAT115	Dater Montessori School	10/26/2016	7:38	CPD_DAT_FL1_1115NATURECENTER_RSINK_DAT115	Lead, ppb	2.2	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT116	Dater Montessori School	10/26/2016	7:38	CPD_DAT_FL1_1115NATURECENTER_RDF_DAT116	Lead, ppb	<1	Less than detection level
DAT117	Dater Montessori School	10/26/2016	7:39	CPS_DAT_FL1_1114_SINK_DAT117	Lead, ppb	<1	Less than detection level
DAT118	Dater Montessori School	10/26/2016	7:39	CPS_DAT_FL1_1114_DF_DAT118	Lead, ppb	<1	Less than detection level
DAT119	Dater Montessori School	10/26/2016	7:39	CPS_DAT_FL1_1114RR_SINK_DAT119	Lead, ppb	1.01	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT120	Dater Montessori School	10/26/2016	7:42	CPS_DAT_FL1_1113_SINK_DAT120	Lead, ppb	<1	Less than detection level
DAT121	Dater Montessori School	10/26/2016	7:42	FL1_DAT_FL1_1113_DF_DAT121	Lead, ppb	<1	Less than detection level
DAT122	Dater Montessori School	10/26/2016	7:43	CPS_DAT_FL1_1113RR_SINK_DAT122	Lead, ppb	<1	Less than detection level
DAT123	Dater Montessori School	10/26/2016	7:43	CPS_DAT_FL1_1112_SINK_DAT123	Lead, ppb	<1	Less than detection level
DAT124	Dater Montessori School	10/26/2016	7:43	CPS_DAT_FL1_1112_DF_DAT124	Lead, ppb	<1	Less than detection level
DAT125	Dater Montessori School	10/26/2016	7:43	CPS_DAT_FL1_1112RR_SINK_DAT125	Lead, ppb	<1	Less than detection level
DAT126	Dater Montessori School	10/26/2016	7:44	CPS_DAT_FL1_1111_SINK_DAT126	Lead, ppb	<1	Less than detection level
DAT127	Dater Montessori School	10/26/2016	7:44	CPS_DAT_FL1_1111_SINK_DAT127	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT128	Dater Montessori School	10/26/2016	7:44	CPS_DAT_FL1_1111RR_SINK_DAT128	Lead, ppb	<1	Less than detection level
DAT129	Dater Montessori School	N/A	N/A	CPS_DAT_FL1_HALLWAYNEAR1106_DF	Lead, ppb	N/A	sample bottle dropped; broke.
DAT130	Dater Montessori School	10/26/2016	7:48	CPS_DAT_FL1_1106ART_LSINK_DAT130	Lead, ppb	1.79	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT131	Dater Montessori School	10/26/2016	7:48	CPS_DAT_FL1_1106ART_MSINK_DAT131	Lead, ppb	<1	Less than detection level
DAT132	Dater Montessori School	10/26/2016	7:48	CPS_DAT_FL1_1106ART_RSINK_DAT132	Lead, ppb	<1	Less than detection level
DAT133	Dater Montessori School	10/26/2016	7:48	CPS_DAT_FL1_1106ART_RDF_DAT133	Lead, ppb	<1	Less than detection level
DAT134	Dater Montessori School	10/26/2016	7:49	CPS_DAT_FL1_1102MUSIC_SINK_DAT134	Lead, ppb	5.02	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT135	Dater Montessori School	10/26/2016	7:49	CPS_DAT_FL1_1102MUSIC_DF_DAT135	Lead, ppb	1.45	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT136	Dater Montessori School	10/26/2016	7:49	CPS_DAT_FL1_1105MUSICSTORE_SINK_DAT136	Lead, ppb	9.32	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT137	Dater Montessori School	10/26/2016	7:49	CPS_DAT_FL1_1105MUSICSTORE_DF_DAT137	Lead, ppb	6.28	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT138	Dater Montessori School	10/26/2016	8:01	CPS_DAT_FL1_2003_SINK_DAT138	Lead, ppb	<1	Less than detection level
DAT139	Dater Montessori School	10/26/2016	8:01	CPS_DAT_FL2_2003_DF_DAT139	Lead, ppb	<1	Less than detection level
DAT140	Dater Montessori School	10/26/2016	8:01	CPS_DAT_FL2_HALLWAYNEAR2001_DF_DAT140	Lead, ppb	<1	Less than detection level
DAT141	Dater Montessori School	10/26/2016	8:02	CPS_DAT_FL2_2001_SINK_DAT141	Lead, ppb	<1	Less than detection level
DAT142	Dater Montessori School	10/26/2016	8:02	CPS_DAT_FL2_2001_DF_DAT142	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT143	Dater Montessori School	10/26/2016	8:02	CPS_DAT_FL2_2006_SINK_DAT143	Lead, ppb	<1	Less than detection level
DAT144	Dater Montessori School	10/26/2016	8:02	CPS_DAT_FL2_2006_DF_DAT144	Lead, ppb	<1	Less than detection level
DAT145	Dater Montessori School	10/26/2016	8:03	CPS_DAT_FL2_2007_SINK_DAT145	Lead, ppb	<1	Less than detection level
DAT146	Dater Montessori School	10/26/2016	8:03	CPS_DAT_FL2_2007_DF_DAT146	Lead, ppb	<1	Less than detection level
DAT147	Dater Montessori School	10/26/2016	8:05	CPS_DAT_FL2_2008_SINK_DAT147	Lead, ppb	<1	Less than detection level
DAT148	Dater Montessori School	10/26/2016	8:05	CPS_DAT_FL2_2008_DF_DAT148	Lead, ppb	<1	Less than detection level
DAT149	Dater Montessori School	10/26/2016	8:07	CPS_DAT_FL2_2009STAFFWORK_SINK_DAT149	Lead, ppb	<1	Less than detection level
DAT150	Dater Montessori School	10/26/2016	8:07	CPS_DAT_FL2_2009STAFFWORK_DF_DAT150	Lead, ppb	<1	Less than detection level
DAT151	Dater Montessori School	10/26/2016	8:08	CPS_DAT_FL2_2015_SINK_DAT151	Lead, ppb	<1	Less than detection level
DAT152	Dater Montessori School	10/26/2016	8:08	CPS_DAT_FL2_2015_DF_DAT152	Lead, ppb	<1	Less than detection level
DAT153	Dater Montessori School	10/26/2016	8:08	CPS_DAT_FL2_2014STAFFMENSRR_SINK_DAT153	Lead, ppb	<1	Less than detection level
DAT154	Dater Montessori School	10/26/2016	8:08	CPS_DAT_FL2_2013STAFFWOMENSRR_SINK_DAT154	Lead, ppb	1.18	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT155	Dater Montessori School	10/26/2016	8:10	CPS_DAT_FL2_2016GIRLSRR_LSINK_DAT155	Lead, ppb	<1	Less than detection level
DAT156	Dater Montessori School	10/26/2016	8:10	CPS_DAT_FL2_2016GIRLSRR_SINK_MSINK_DAT156	Lead, ppb	<1	Less than detection level
DAT157	Dater Montessori School	10/26/2016	8:10	CPS_DAT_FL2_2016GIRLSSRR_SINK_RSINK_DAT157	Lead, ppb	<1	Less than detection level
DAT158	Dater Montessori School	10/26/2016	8:12	CPS_DAT_FL2_2017_SINK_DAT158	Lead, ppb	<1	Less than detection level
DAT159	Dater Montessori School	10/26/2016	8:12	CPS_DAT_FL2_2017_DF_DAT159	Lead, ppb	<1	Less than detection level
DAT160	Dater Montessori School	10/26/2016	8:13	CPS_DAT_FL2_2021_SINK_DAT160	Lead, ppb	<1	Less than detection level
DAT161	Dater Montessori School	10/26/2016	8:13	CPS_DAT_FL2_2021_DF_DAT161	Lead, ppb	<1	Less than detection level
DAT162	Dater Montessori School	10/26/2016	8:13	CPS_DAT_FL2_2019BOYSRR_LSINK_DAT162	Lead, ppb	<1	Less than detection level
DAT163	Dater Montessori School	10/26/2016	8:13	CPS_DAT_FL2_2019BOYSRR_MSINK_DAT163	Lead, ppb	<1	Less than detection level

Cincinnati Public Schools - Dater Montessori School- Lead Testing Results

SAMPLE #	SCHOOL	SAMPLE DATE	SAMPLE TIME	SAMPLE NAME	PARAMETER CODE	AMOUNT	GCWW COMMENTS/REVIEW/RECOMMENDATIONS REGARDING RESULTS
DAT164	Dater Montessori School	10/26/2016	8:13	CPS_DAT_FL2_2019BOYSRR_RSINK_DAT164	Lead, ppb	<1	Less than detection level
DAT165	Dater Montessori School	10/26/2016	8:15	CPS_DAT_FL2_HALLWAYNEAR2022_DF_DAT165	Lead, ppb	<1	Less than detection level
DAT166	Dater Montessori School	10/26/2016	8:16	CPS_DAT_FL2_2022_SINK_DAT166	Lead, ppb	1.58	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT167	Dater Montessori School	10/26/2016	8:16	CPS_DAT_FL2_2022_DF_DAT167	Lead, ppb	<1	Less than detection level
DAT168	Dater Montessori School	10/26/2016	8:17	CPS_DAT_FL2_2023_SINK_DAT168	Lead, ppb	<1	Less than detection level
DAT169	Dater Montessori School	10/26/2016	8:17	CPS_DAT_FL2_2023_DF_DAT169	Lead, ppb	<1	Less than detection level
DAT170	Dater Montessori School	10/26/2016	8:18	CPS_DAT_FL2_2024_SINK_DAT170	Lead, ppb	<1	Less than detection level
DAT171	Dater Montessori School	10/26/2016	8:18	CPS_DAT_FL2_2024_DF_DAT171	Lead, ppb	<1	Less than detection level
DAT172	Dater Montessori School	10/26/2016	8:19	CPS_DAT_FL2_2025_SINK_DAT172	Lead, ppb	<1	Less than detection level
DAT173	Dater Montessori School	10/26/2016	8:19	CPS_DAT_FL2_2025_DF_DAT173	Lead, ppb	<1	Less than detection level
DAT174	Dater Montessori School	10/26/2016	8:20	CPS_DAT_FL2_2026_SINK_DAT174	Lead, ppb	1.21	Lead detected; less than 15ppb action level. Review 3Ts Guidelines to understand options to further reduce the risk of lead.
DAT175	Dater Montessori School	10/26/2016	8:20	CPS_DAT_FL2_2026_DF_DAT175	Lead, ppb	<1	Less than detection level
DAT176	Dater Montessori School	10/26/2016	8:20	CPS_DAT_FL2_2027_SINK_DAT176	Lead, ppb	<1	Less than detection level
DAT177	Dater Montessori School	10/26/2016	8:20	CPS_DAT_FL2_2027_DF_DAT177	Lead, ppb	<1	Less than detection level
DAT178	Dater Montessori School	10/26/2016	8:21	CPS_DAT_FL2_HALLWAYNEAR2027_DF_DAT178	Lead, ppb	<1	Less than detection level
DAT179	Dater Montessori School	10/26/2016	8:21	CPS_DAT_FL1_1036STAFFWORK_DF_DAT179	Lead, ppb	<1	Less than detection level